


Date: July 8, 2004
Product: ASHTECH SOLUTIONS V 2.7
Subject: DOWNLOAD V 2.74
Number: AS 2004_06

Introduction:

Recently, some customers report having trouble when downloading raw data files from ASHTECH LOCUS and PROMARK2 Receivers. The trouble occurs after they have upgraded the Ashtech Solutions software V2.6 to V2.7

Known Problems:

The Ashtech Solutions Download software can not connect to a LOCUS receiver through the IR port. The following message appears on the computer screen:

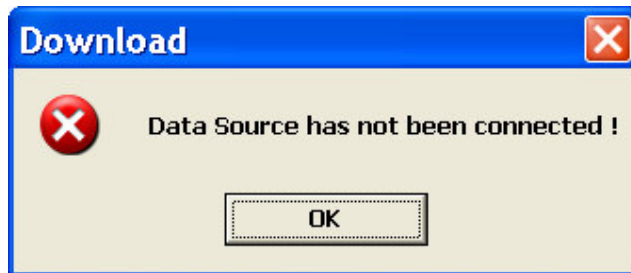

Occasionally, there could be a transfer error when downloading large raw data files from PROMARK 2 receivers. This problem seems to occur on computers running Windows 98SE more often.

Work around:

The problem can be fixed by using the old version of Download, V2.60
After the Ashtech Solutions V2.7 installation on your computer, overwrite the 2 following files in Ashtech Solutions/Bin folder

Dload32.exe (dated on 08/08/2002; 225 280 bytes)
Engine32.DLL (dated on 08/08/2002; 139 264 bytes)

Those 2 files can be downloaded from the Thales Navigation FTP site at:

<ftp.thalesnavigation.com>