



Firmware Release Notes

Survey

Date: March 21, 2014
Product: ProMark700
Subject: PM700 V 4.82 Firmware Release


Introduction:

This document is the firmware release note of the [ProMark 700 GNSS FW v4.82 \(including MSL FW 1.31\)](#). The firmware upgrade to v4.82 does not require any upgrade code.


Upgrade procedure

The procedure to upgrade the receiver is as follows:

1. Copy the following 2 files: [ProMark 700 Loader V2.2.exe](#) and [Setup.msi](#) on you PC
2. Execute the [ProMark 700 Loader V2.2.exe](#) file
3. Copy the [V131_V482.bin](#) file on your computer
4. Launch the [ProMark 700 Loader](#) tool

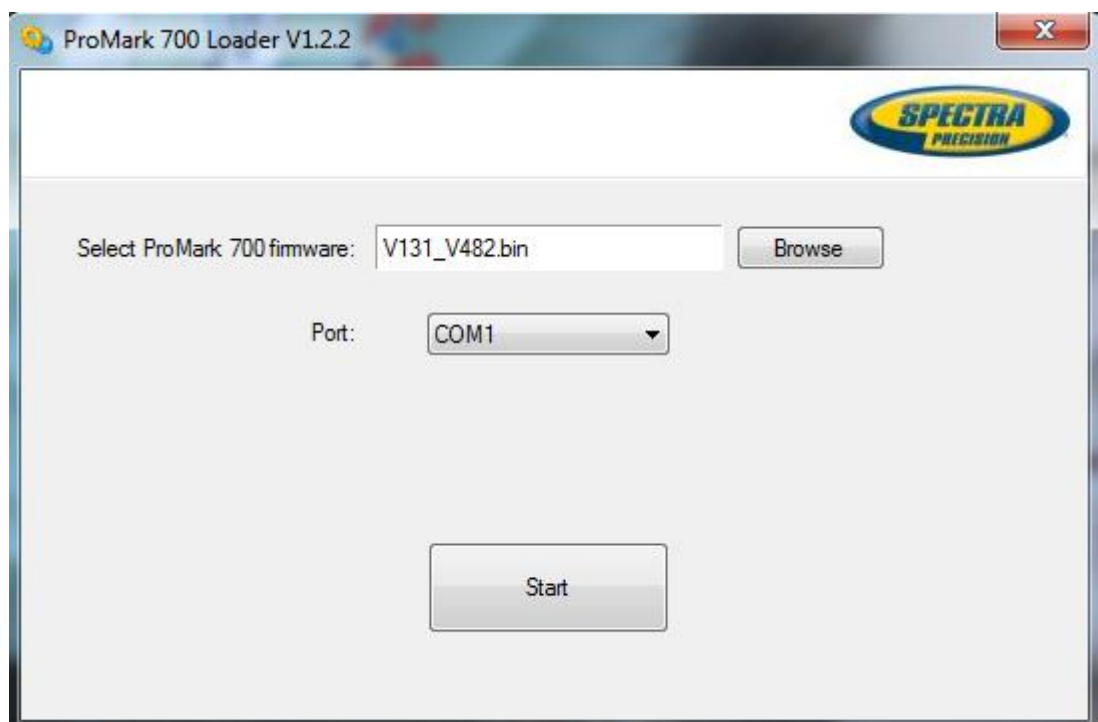

5. Click on the Browse button to select the new ProMark 700 firmware file ([V131_V482.bin](#))
6. Connect the ProMark 700 receiver to your computer via Bluetooth or Serial Port
7. Select the right [Port COM](#) and click on [Start](#) button
8. The following view appears:

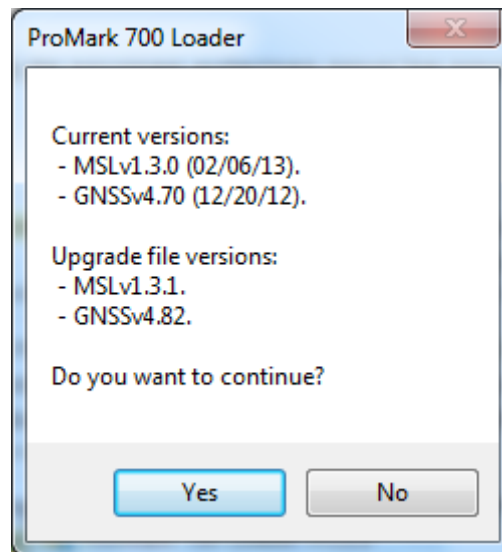

9. Press the [Yes](#) button and follow instructions.

Firmware list and versions

General version number: [V1.3.1 – 18/02/2014](#)

The software compatible with ProMark 700 V1.3.1_V4.82:

- FAST Survey: [4.0.7](#)
- Survey Pro: [5.4.1](#)
- Survey Office (32-bits): [2.96](#)
- Survey Office (64-bits): [3.11](#)

New features

No New features

Resolved Problems

- SBAS mode is set now to ON by default (it was OFF)